



Service Info



Tensioner arm 533 0075 30

Be sure to observe screw length

Manufacturer: Seat, Volkswagen

Models:

Seat: Alhambra, Cordoba, Ibiza, Inca, Toledo

Volkswagen: Caddy, Golf, Polo, Sharan, Transporter, Vento

Enginecode: AAC, AAM, ABA, ABS, ABF, ABN, ACC, ADC, ADD, ADL, ADY, ADZ, AEH, AEK, AEP, AER, AFT, AGG, AKL, AKR, AKS, ANN, ANP, APF, ATM, ATU, AUR, AWF, AWG, AXG, EZ, 2E, 1F

Part no.: 533 0075 30
529 0089 10

For current listing refer to catalogue media

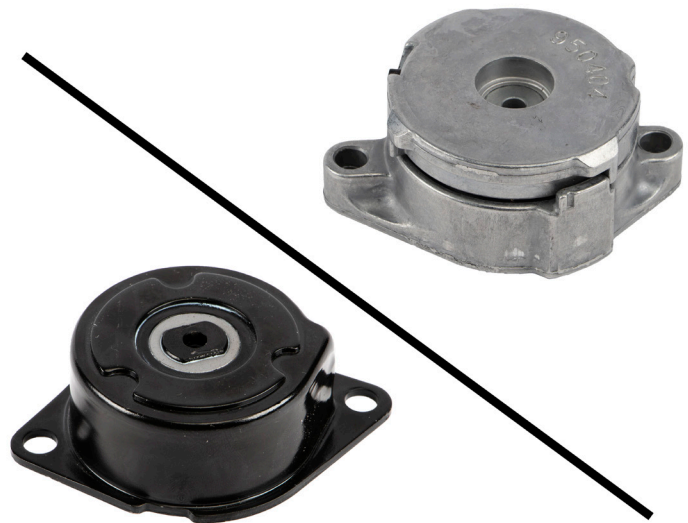


Photo: Right, old design / left, new design

As part of the ongoing development of our products, tensioner arm 533 0075 30 has been modified. Proper installation of this new design requires shorter screws. The M8x35 screws have been replaced by M8x22 screws.

For correct repair using the new tensioner arm 533 0075 30, only M8x22 size screws may be used!

The Service Information bulletin shows the visual features of the previous design (pictured at right) and the new design (pictured at left).

During the conversion phase, stocks may become mixed with both new and old design parts.

Please observe the vehicle manufacturer specifications!

You want more? We can help!

Phone: +44 (0) 1432 264 264

Fax: +44 (0) 1432 375 760

aftermarket.uk@schaeffler.com

www.repxpert.co.uk



SCHAEFFLER

REP>XPERT